Heating, Refrigeration & Ventilation Motors

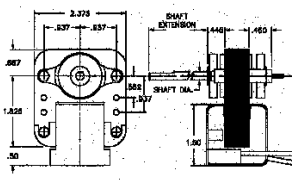

Features:

- All Angle Mount
- Class A Insulation
- Continuos Duty, Air Over
- UL Recognized and CSA Certified
- Packed Individually
- Mechanically Reversible
- Impedance Protected
- Shaded Pole
- 3000 RPM
- 60 Hz

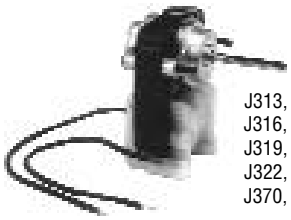

J313, J314, J315, J316, J317, J318, J319, J320, J321, J322, J352, J354, J370, J372, J373

J323, J325, J326, J327, J328, J375, J550

Replacement motors for commercial and residential freezer and refrigerator evaporators, vending machines, range hoods, exhaust fans, heaters, air cleaners, humidifier and other popular equipment.

J334, J335

J333

J329

J551, J554

J336

Stack Size	RPM/ Speeds	Volts	Amps	Stock Number	Alternate	Shaft Dia. & Length	Bearing	Rotation*	Flat Length	Notes
3/8"	3000/1	120	0.27	**J325**		.181 x 1	SLEEVE	CWSE	NONE	3
3/8"	3000/1	120	0.33	**J313**		1/8 x 1-1/4	SLEEVE	CWSE	NONE	1
1/2"	3000/1	115	0.32	**J314**		3/16 x 1	SLEEVE	CWSE	NONE	3
1/2"	3000/1	120	0.20	**J336**		1/8 x 1	SLEEVE	CWSE	NONE	2
1/2"	3000/1	120	0.30	**J334**		3/16 x 1-3/4	SLEEVE	CWSE	NONE	
1/2"	3000/1	120	0.32	**J333**		1/8 x 1-1/4	SLEEVE	CCWSE	NONE	
1/2"	3000/1	120	0.45	**J354**		.181 x 1-1/2	SLEEVE	CCWSE	1.20	
1/2"	3000/1	120	0.75	**J550**		7/32 x 1-3/4	SLEEVE	CCWSE	0.625	
1/2"	3000/1	230	0.15	**J315**		3/16 x 1	SLEEVE	CWSE	NONE	3
1/2"	3000/1	240	0.22	**J352**		.181 x 1-1/2	SLEEVE	CCWSE	1.20	
5/8"	3000/1	115	0.43	**J316**		3/16 x 1	SLEEVE	CWSE	NONE	3
5/8"	2750/1	115	0.47	**J323**		7/32 x 2-3/8	SLEEVE	CWSE	0.87	
5/8"	3000/1	115	0.51	**J320**		3/16 x 2	BALL	CWSE	NONE	3,5
5/8"	2850/1	115	0.68	**J327**		3/16 x 1-9/16	SLEEVE	CWSE	0.75	
5/8"	3000/1	120	0.34	**J335**		3/16 x 11/2	SLEEVE	CWSE	NONE	
5/8"	3000/1	120	0.50	**J324**		.181 x 1-3/8	SLEEVE	CWSE	NONE	
5/8"	3000/1	120	0.50	**J370**		3/16 x 1-1/2	SLEEVE	CWSE	NONE	
5/8"	3000/1550/2	120	1.30	**J373**		3/16 x 1-1/2	SLEEVE	CWSE	NONE	4
5/8"	3000/1	120	0.65	**J375**		.181 x 1-1/2	SLEEVE	CCWSE	0.78	
5/8"	3000/1	230	0.21	**J317**		3/16 x 1	SLEEVE	CWSE	NONE	3
5/8"	3000/1	240	0.25	**J372**		3/16 x 1-1/2	SLEEVE	CWSE	NONE	
3/4"	3000/1	115	0.75	**J328**		.217 x 1-1/4	SLEEVE	CCWSE	0.875	
3/4"	3000/1	115	0.90	**J330**		.217 x 2-3/8	SLEEVE	CCWSE	2.15	
7/8"	3000/1	115	0.47	**J318**		3/16 x 1	SLEEVE	CWSE	NONE	3
7/8"	3000/1	115	0.88	**J319**		3/16 x 1	SLEEVE	CWSE	NONE	3
7/8"	3000/1	115	0.88	**J321**		3/16 x 2	BALL	CWSE	NONE	3,5
7/8"	3000/1550/2	120	0.70	**J551**		7/32 x 1-5/8	SLEEVE	CWSE	0.75	4
7/8"	3000/1	120	1.05	**J326**		.217 x 1-1/4	SLEEVE	CCWSE	.675	
7/8"	3000/1550/2	120	1.10	**J554**		7/32 x 1-1/2	SLEEVE	CCWSE	1.00	4
1-1/8"	3000/1	240	0.60	**J329**		7/32 x 1	SLEEVE	CCWSE	0.75	
1-1/2"	3000/1	115	1.10	**J322**		1/4 x 2	BALL	CWSE		5

Notes:
1. Motor fits tongue mount 2. Motor is center mounted 3. Shaft has no flat
4. Motor is thermally protected 5. Ball Bearing
*To reverse the rotation of a C-Frame motor, remove the shaft from one side of the stack and re-install it back on the opposite side of the stack.